

Date: Thursday, 3/30/2006 8:34:06 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : AFT TUBE ASSEMBLY
 Job Number : 26434
 Estimate Number : 10699
 P.O. Number : N/A Part Number : D3391025
 This Issue : 3/30/2006 S.O. No. : N/A Drawing Number : D3391 REV D
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D
 Previous Run : 26433 Material : N/A
 Due Date : 4/20/2006 Qty: 1 Um: Each
 Written By : See Comment Below
 Checked & Approved By : 06.03.30
 Comment : Est Rev B 06-02-07 ECN773 dwg rev. D EC
 Est Rev: C 06-03-28 Update Manufacturing Instructions JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D6014090 ALUMINUM EXTRUSION



Comment: Qty.: 1.0000 f(s)/Unit Total : 1.0000 f(s)

ALUMINUM EXTRUSION

Pick:

Qty Part Number Description Batch

1 D6014-090 Extrusion 24315 (D6014-104) MS 06/04/01 1

Identify as D3391-3

2.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

Turn as per Folio FA599

Rev: AA & Dwg D3391 Rev: C

MS 06/04/01 1

3.0 QC2 INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

MS 06/04/02 1

4.0 HAAS1 HAAS CNC VERTICAL MACHINING #1



Comment: HAAS

1-Machine as per Folio FA 599 Rev: AA & Dwg D3391 Rev: D

2-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

3-Deburr

RG 06-04-05 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:34:06 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 26434

Part Number: D3391025

Job Number:



Seq. #: Machine Or Operation:

Description :

5.0 QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

RG 06-04-05

6.0 QC8

SECOND CHECK



Comment: SECOND CHECK

EN 06/04/07

7.0 BENDING

BENDING MACHINE



Comment: NC Bender

Form as per Dwg D3391 Using Bend Prog 3391025

DP06-4-9

8.0 QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06-04-10

9.0 LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Aft cap pilot hole to .208" as per Dwg D3391

DP06-4-10

2-Drill Tube as per D3391 using DT8809 (HOLES MARKED "A".ONLY)

DP06-4-10

3-Drill and c' sink wearshoe holes as per Dwg D3391 Using DT8878(Mid Tube) & DT8217 Wearplate Jig

BE 06-04-11

4-C'sink holes for float bag (4 holes per side) as per Dwg D3391

BE 06-04-11

5-Deburr

BE 06-04-11

Tools: rill

10.0 QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06-04-11

11.0 HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

a-m 06-04-12

DP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:34:06 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 26434

Part Number: D3391025

Job Number:



Seq. #: Machine Or Operation: Description :

12.0 POWDER COATING POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

DL 06/04/13 ①

13.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

14.0 AECS10KB366 INSERT



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Insert

Pick:

Qty Part Number Description Batch

14 AECS10KB366 Insert

M17905 ✓

15.0 NAS1330C3KB166



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

INSERT

Pick:

Qty Part Number Description Batch

8 NAS1330C3KB166 Insert

M18308

16.0 AECS10KB266 INSERT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

INSERT

Pick:

Qty Part Number Description Batch

2 AECS10KB266 Insert

M17905 ✓

or NAS1330C3KB266

17.0 AECS10KB316 INSERT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

INSERT

Pick:

Qty Part Number Description Batch

2 AECS10KB316 Insert

M17905

or NAS1330C3KB316

DL 06/04/13 ①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:34:07 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 26434

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Aft Cap

Pick:

Qty	Part Number	Description	Batch
1	D2646	Aft Cap	B23370B /

19.0

AN3C4A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Pick:

Qty	Part Number	Description	Batch
2	AN3C4A	Bolt	M19522 /

20.0

AN960C10L

washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Inventory

Pick:

Qty	Part Number	Description	Batch
2	AN960C10L	Washer	M18822 /

21.0

NAS1515H3L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Pick:

Qty	Part Number	Description	Batch
2	NAS1515H3L	Washer	M19185

DL 06/04/18

①

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

1-Install inserts as per Dwg D3391

DL 06/04/18

①

2-Install Aft Cap as per Dwg D3391

A/R Sikaflex-241/-291 M100480

Sikaflex expiry date: 11/02/06

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: SD Date: 06/04/24
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/30/2006 8:34:07 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 26434

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

QC5

INSPECT WORK TO CURRENT STEP



06-04-18

Comment: INSPECT WORK TO CURRENT STEP

24.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: *MA*

DC 06/04/18 (1)

25.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

DP 06/04/24 (1)

Job Completion



u 06-04-24

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

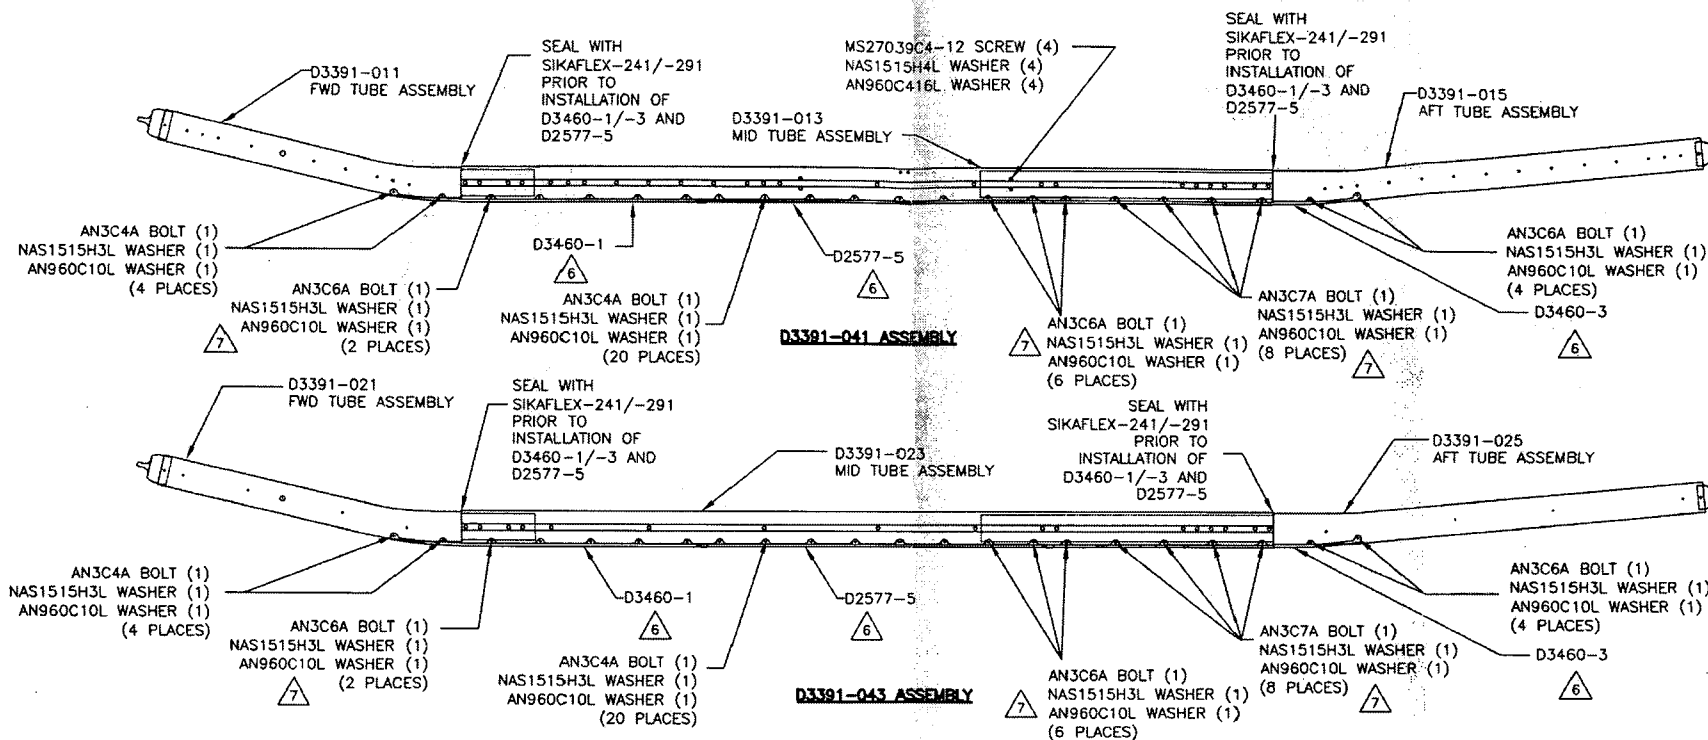

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY - 041	QTY - 043	PART NUMBER	DESCRIPTION
X	X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
		D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
24	24	AN3C4A	BOLT
12	12	AN3C6A	BOLT
8	8	AN3C7A	BOLT
44	44	NAS1515H3L	WASHER
44	44	AN960C10L	WASHER
4		MS27039C4-12	SCREW
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
1	1	D2577-5	WEARSHOE
1	1	D3460-1	WEARSHOE
1	1	D3460-3	WEARSHOE

GENERAL NOTES

- ALL DIMENSIONS ARE IN INCHES
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- FINISH: ACID ETCH AND ALODINE PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 'E' SIZE HOLES (#0.250-#0.257) FOR WEARSHOE INSERTS. C/SINK #0.391/#0.425 x 100" AS APPLICABLE AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES
- DO NOT TORQUE, HAND TIGHTEN ONLY

RELEASED

06.01.27










D	06.01.23	UPDATE TOLERANCE, CHANGE HOLE SIZE
C	05.09.27	LENGTHEN AFT EXTENSION
B	05.06.10	DRAWING UPDATES
A	05.02.07	NEW ISSUE
DESIGN	PH	DRAWN BY PH
CHECKED	#	APPROVED #
DATE	06.01.23	DRAWING NO. D3391
		TITLE 412 FLOAT SKIDTUBE
		REV. D SHEET 1 OF 5
		SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DART DART AEROSPACE USA, INC.
PORT HADLOCK, OH


WORK ORDER
204734
RETURN TO
ENGINEERING
FOR ROLLED COPY
WITHOUT NOTICE

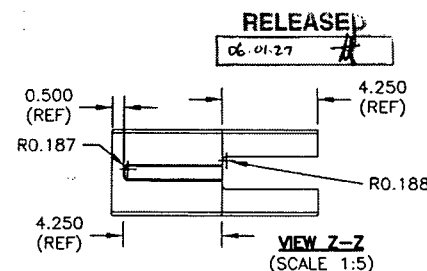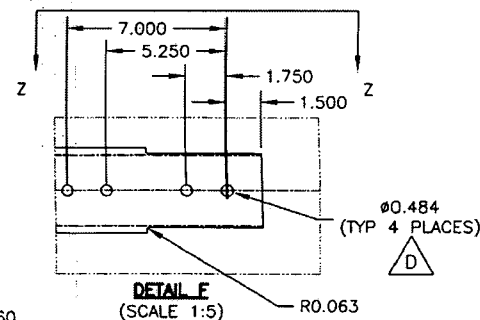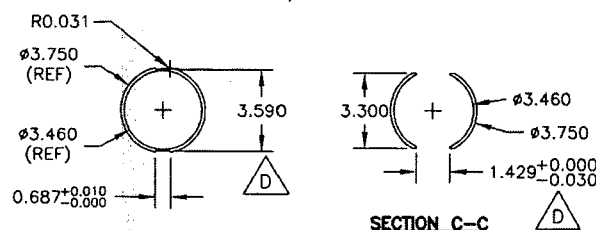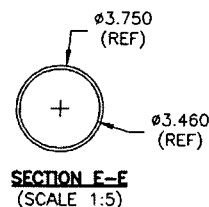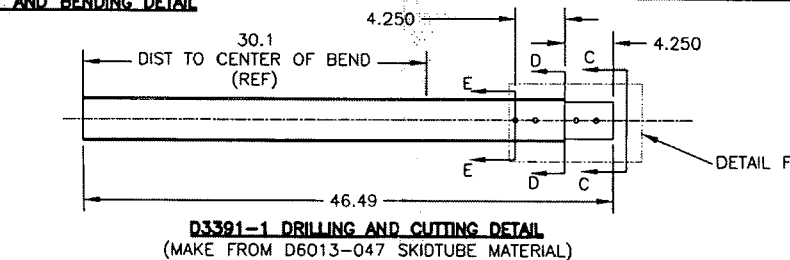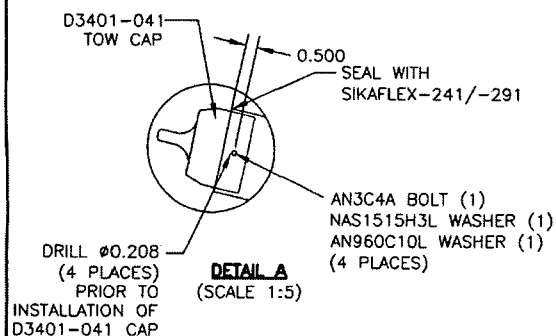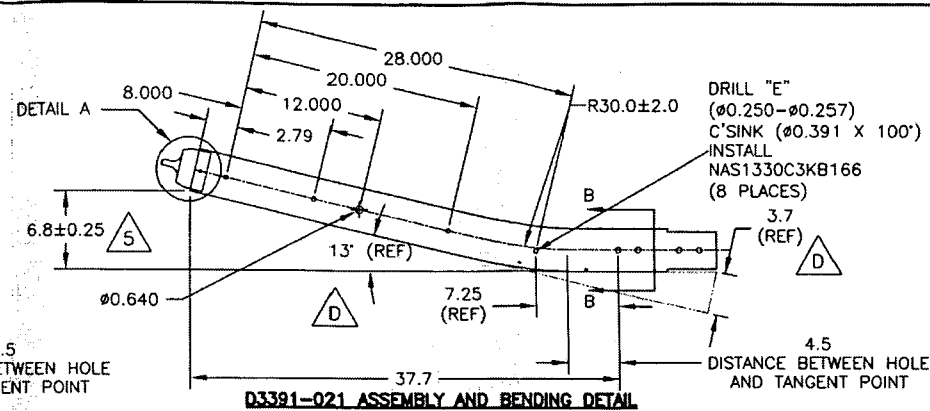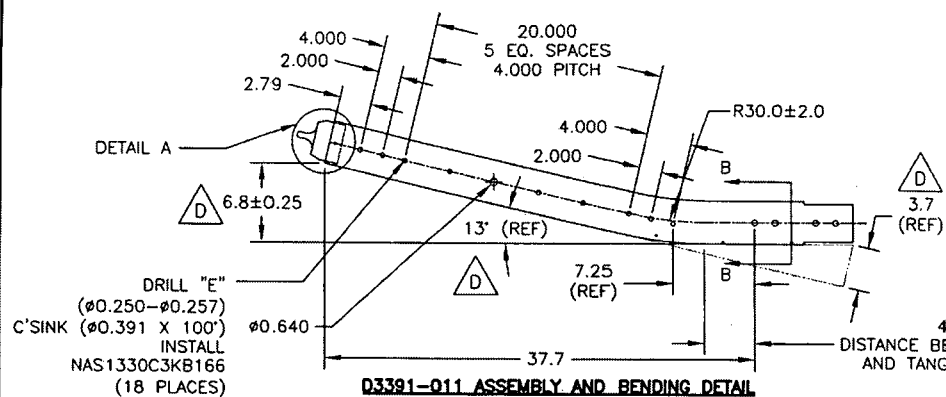

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
4	4	AN3C4A	BOLT
4	4	NAS1515H3L	WASHER
4	4	AN960C10L	WASHER
24	14	NAS1330C3KB166	INSERT

NO. 204734
 WORK ORDER
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 ENGINEERING
 RETURN TO
 ONLY

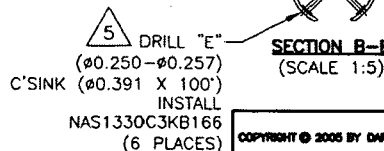

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH

CHECKED

DATE 06.01.23

DRAWN BY PH

APPROVED

DATE

DART

DART AEROSPACE USA, INC.

PORT HADLOCK, OH




DRAWING NO. D3391

TITLE 412 FLOAT SKIDTUBE




REV. D SHEET 2 OF 5

SCALE 1:10

RELEASED 06.01.27

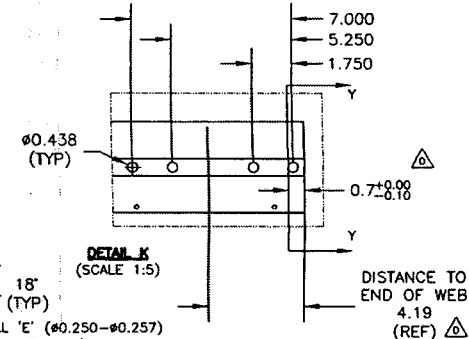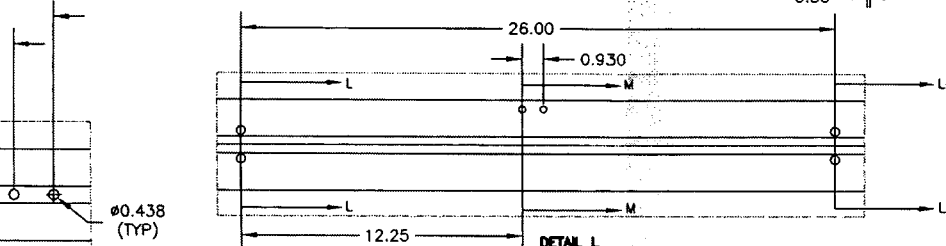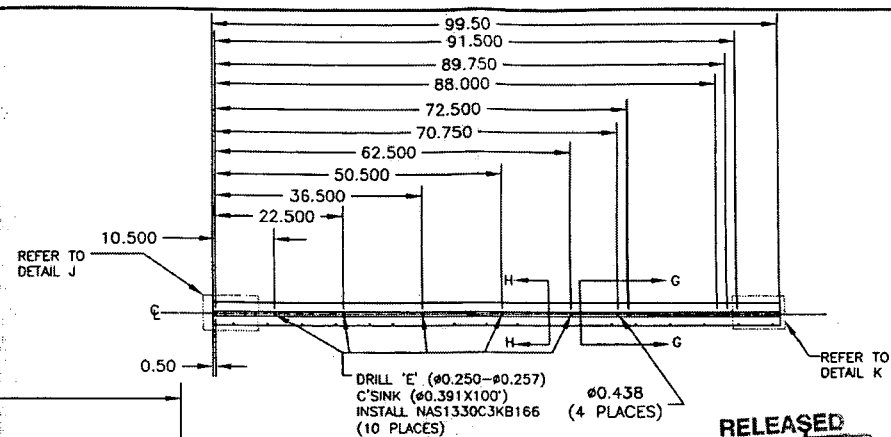

QTY - 013	QTY - 023	PART NUMBER	DESCRIPTION
X		D3391-013	MID TUBE ASSEMBLY
	X	D3391-023	MID TUBE ASSEMBLY
1	1	D2500-1-100	EXTRUSION
1	1	D3389-1	WEB
24	20	NAS1330C3KB116	INSERT
24	10	NAS1330C3KB166	INSERT
4		NAS1329C4KB140	INSERT
4		NAS1515H3L	WASHER
4		AN960C10L	WASHER
4		NAS1515H4L	WASHER
4		AN960C416L	WASHER
4		MS27039C1-09	SCREW
4		MS27039C4-08	SCREW

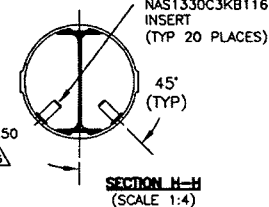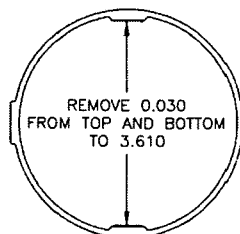

SECTION X-X
(SCALE 1:2)

COPYRIGHT © 2006 BY DART AEROSPACE USA, INC.

DESIGN	
PH	

DRAWN BY	PH
----------	----

DART DART AEROSPACE USA, INC.
PORT HADLOCK, VA

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

CHECKED 

APPROVED	
----------	--

DRAWING NO.	D3391
-------------	-------

REV. 11-1-68
SHEET 3 OF 3


D3391-013/-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI Q15


SECTION
(SCALE)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
NOTICE


WORK ORDER
O. 26434

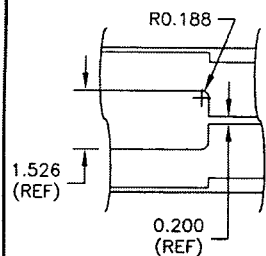

VIEW BB-BB
(SCALE 1:3)

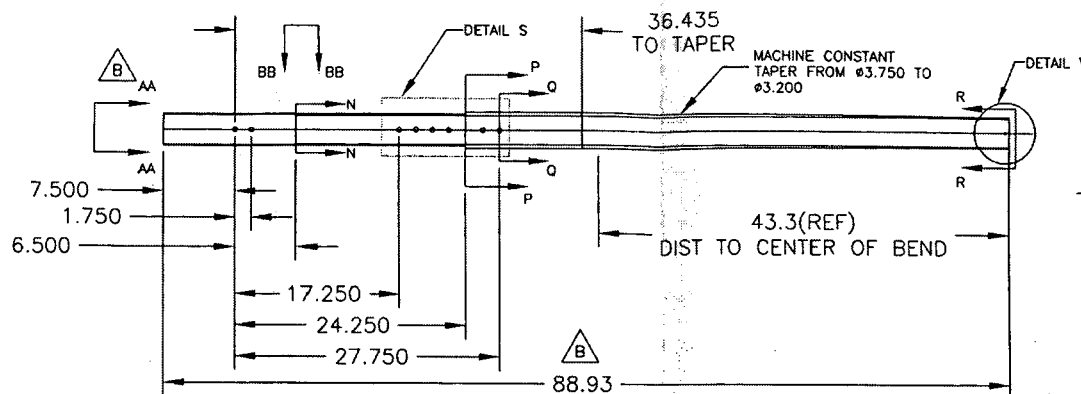

D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

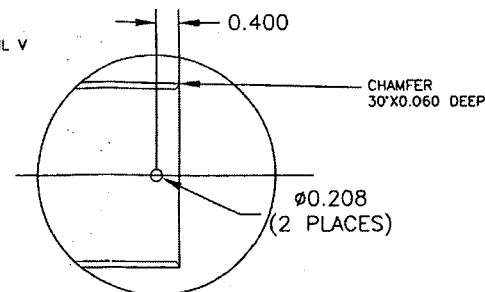


DETAIL V
(SCALE 1:2)


RELEASED

06.01.23


1.526^{+0.000}_{-0.030}

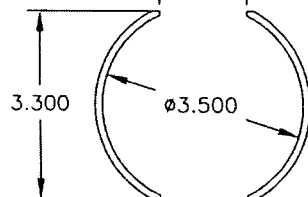


SECTION AA-AA
(SCALE 1:2)

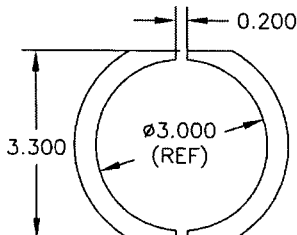


SECTION N-N
(SCALE 1:2)

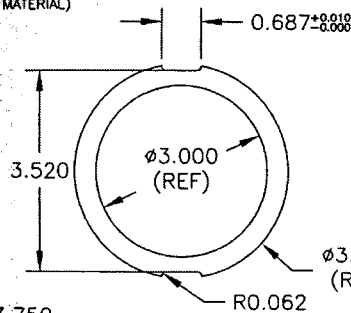


SECTION P-P
(SCALE 1:2)

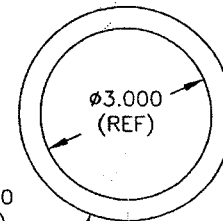


SECTION Q-Q
(SCALE 1:2)

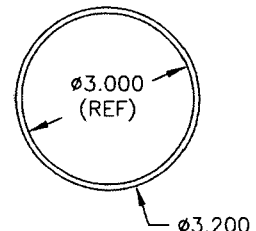

SECTION R-R
(SCALE 1:2)

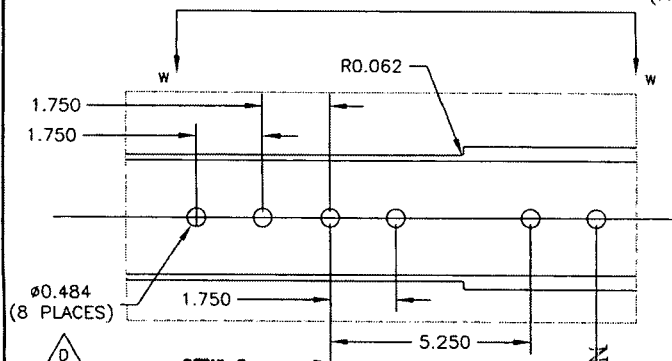

DETAIL S
(SCALE 1:3)

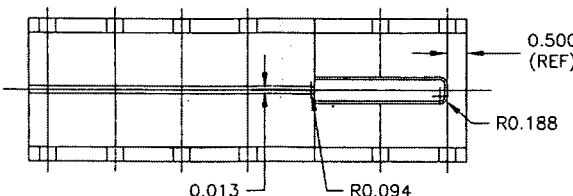

VIEW W-W
(SCALE 1:3)

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. D
CHECKED	#	APPROVED	#	DRAWING NO. D3391	SHEET 4 OF 5
DATE	06.01.23	TITLE	412 FLOAT SKIDTUBE	SCALE	1:12

UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
26434
SHOP COPY
RETURN TO
ENGINEERING

Page 1 of 1

Prototype

Pitch

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/RF	

